

N2130L

1976 Beech 58TC Baron

LH Prop Logbook

Aircraft S/N: TK-25



RidgeAire
WORLDWIDE
aviation specialists

Prepared by the worldwide aviation specialists at RidgeAire, Inc.

N2130L

HARTZELL

**LEFT
PROPELLER LOGBOOK**

PROPELLER MODEL PHC-J3YF-2UF/FC7663DR

PROPELLER S/N ED5311B

LOGBOOK # 1

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
6-24-08	0		<p>Install new de-Kersdch propellers</p> <p>Portient details of the repair are on file at this agency under</p> <p>WORK ORDER NO. <u>15472</u></p> <p>DATED <u>6-24-08</u></p> <p>SIGNED <u>[Signature]</u></p> <p>For Precision Propeller Service, Inc. FAA Repair Station No. <u>DJR947L</u></p>

N2130L Date: 7/8/2008 Tach: 828.2
 Installed new propeller model: PHC J3YF 2UF, S/N ED5311B on N2130L Beech
 58TC S/N TK25, OPS and leak check good, approved for service.
Dana Brewer 307646159IA

				<p>Left Propeller</p> <p>04-09-2009 N2130L Hartzell PHC-J3YF-2UF/FC7663DR S/N: ED5311B</p> <p>Hobbs: 872 SMOH: 044 Hobbs Total: 044</p> <p>C/W Annual inspection. Dressed leading edges and painted blade faces. I certify that this propeller has been inspected IAW an annual inspection, and has been determined to be in an airworthy condition.</p> <p><i>[Signature]</i> John J. Loftus 1676069171A</p>
				<p>Left Propeller</p> <p>05-17-2010 N2130L Hartzell PHC-J3YF-2UF/FC7663DR S/N: ED5311B</p> <p>Hobbs: 968 SMOH: 140 Total: 140</p> <p>C/W Annual inspection. Dressed leading edges and painted blade faces. I certify that this propeller has been inspected IAW an annual inspection, and has been determined to be in an airworthy condition.</p> <p><i>[Signature]</i> John J. Loftus 1676069171A</p>

SEE OTHER SIDE


Maintenance Release

Part Hartzell

Model PHC J3YF 2UF

The component identified above was repaired/
~~overhauled~~ and inspected in accordance with
current Federal air regulations and was found
air-worthy for return to service. Pertinent details
of the repair are on file at this agency under Work
Order No. 15472

Date 6-24-08

Signed 
Authorized Individual

PRECISION PROPELLER SERVICE, INC.

Weld County Municipal Airport
631 Buss Ave., Greeley, CO 80631

(970) 352-8578

FAA APPROVED REPAIR STATION
NO. UB3R887L

DESCRIPTION OF WORK ACCOMPLISHED

Make Hartzell Model PHC-J3YF-2UF

S/N ED5311B Blades 1 _____ 2 _____ 3 _____ 4 _____

Overhauled _____ Blades Rep. _____ Blade Repair _____ Reseal _____

Repitch _____ Other _____ Service Manual _____

Service Letters _____



Service Bulletins _____


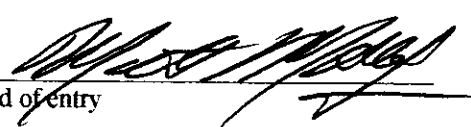


AD's _____ Boot P/N SMR1601-7

Remarks install new de-icers.

Pitch Settings: Low _____ High _____ Reverse _____

TSO _____ TT _____ Feather _____ Latch _____

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
			 Aircraft Propeller Works, Inc.
			Date: 4/2/2013 Model No: PHC-J3YF-2UF / FC7663DRB Serial No: ED5311B APW#: APW5141 This Hartzell Propeller resealed, leading edge cleaned up, blades repainted and static balanced in accordance with Hartzell manuals 202A, 113B and 133C. Approved for return to service. Continue time.
			 Arthur J Michaud Authorized Signature
			FAA Repair Station # T4ZR741Y

		Clearwater Aircraft Maintenance and Services, Inc. 14421 Airport Parkway • Clearwater, FL 33762 727-507-8881 • Fax 727-507-8887	
N2130L Date: 06/14/2013 Work Ord: 7517 Hobbs: 1293.4 SPOH: 465.7		Accomplished an Annual inspection IAW Maintenance Manual on L/H prop. Removed prop and sent out for re-seal. Installed propeller after repair. Dressed and painted propeller as required. Checked AD's thru Zook's Aviation 2013-06A. See AD list in log folder. I certify this propeller has been inspected IAW an annual inspection and was found to be in an airworthy condition on this date.	
		Matt Malouf AP/IA 2841230  End of entry	
			
		Primeplanes Aircraft Services Inc. 240 Aviation Drive North Suite 102 Naples, Florida 34104 ph. 239-659-4005	
REG.	N2130L	TYPE	PHC-J3YF-2UF SERIAL ED5311B HOBBS 1298.8
Reinstalled overhauled Propeller, IAW Hartzell owners manual, and Beechcraft Baron 58TC MM section 61-00-00. Performed ops check. no discrepancies noted at this time. ---END---			
Signature			Date 5/8/2014

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				<p>PROP MODEL (L): PROP S/N (L): REG NO. 2130L WORK ORDER: 6172-07-2014</p> <p><i>Premier</i> Aircraft Service</p> <p>Premier Aircraft Service, Inc. 5540 NW 23rd Avenue Hanger 14 Fort Lauderdale, FL 33309 Phone: (954) 334-2393</p> <p>DATE: 7/25/2014 A/C TSN: 4840 PROP IT (L): 1299 HOBBS: 1300</p> <p>Left Prop Entries</p> <p>(6) C/W ANNUAL INSPECTION ON THIS LEFT PROPELLER IAW FAR 43 APPENDIX D USING BEECH 58TC M/M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED THROUGH CURRENT ON ATP.</p> <p>MAINTENANCE RELEASE: IN REFERENCE TO THE WORK PERFORMED, THIS AIRCRAFT, AIRFRAME, AIRCRAFT ENGINE, PROPELLER, AND / OR APPLIANCE WAS REPAIRED AND INSPECTED IAW CURRENT REGULATIONS OF THE FEDERAL AVIATION ADMINISTRATION AND IS APPROVED FOR RETURN TO SERVICE. ALL WORK WAS PERFORMED IAW CURRENT APPLICABLE AIRCRAFT, ENGINE, OR APPLIANCE MAINTENANCE MANUALS AND INSTRUCTIONS.</p> <p>DATE: 7/25/2014 SIGNED: <i>Emmanuel Vicoso</i> Work Order: 6172-07-2014 Emmanuel Vicoso, IA: 3708718 Printed by EBis 3 (datcomedia.com)</p>



GULFPORT-BILOXI

08/27/15 N2130L Hartzell PHC-J3YF-2UF S/N ED5311B
Hobbs: 1410.1 Prop SMOH: 1410.1 LH Prop

1. Performed 100 hour inspection.
2. Inspected bulkhead, blades, boots and wiring.
3. Serviced with nitrogen to proper pressure.

I certify that this propeller has been inspected in accordance with an ANNUAL inspection and is in an airworthy condition.

Blaine Wills A&P 436983651 IA *Blaine Wills*

Precision Avionics Specialists 207 Barry Whatley Way Griffin, GA 30224
LOG ID# 2113 12-September-2016 WO# 10823 HOBBS 1440.5
N2130L S/N TK-25 BEECH 58TC TSMOH 1440.5

Pg 1 / 1

INSPECTED PROPELLER USING CHECKLIST PREPARED IN ACCORDANCE WITH FAR 43 APPENDIX D. I CERTIFY THIS PROPELLER HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION AS OF THIS DATE.

Scott Collins

A&P 2747448 IA JEFFERY S. COLLINS

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				Hartzell(Left) Model# PHC-J3YF-2UF SER# ED5311B 02/05/2018 SPOH 802
				This date performed an annual inspection, removed all nicks and painted back of blades flat black. Inspected and determined that this prop was found to be in airworthy condition.
				<i>David J. Small IA303652</i>
				Hartzell (Left) model PHCJ3YF2-U SER# ED 5311 B
				10/20/20 Serial 1683.3
				c/w annual inspection w/rotto Beach SSTC m/m
				checked A/D TRU FAD Reserver
				Recently this propeller is Ben Inspected ELO/W
				An annual inspection and it is airworthy condition
				Shaw Thery ADP 186
				3462901
